



Section I--Violation Data

1. Date Mo Da Yr 12/06/2011	2. Time (24 Hr. Clock) 0800	3. Citation/ Order Number 4900516
4. Served To Berman Cornett (Safety Director)	5. Operator Performance Coal Company, et al.	
6. Mine UPPER BIG BRANCH MINE-SOUTH	7. Mine ID 46-08436	(Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

The stageloader and crusher area does not have electrical equipment that is permissible or maintained permissible on the Headgate 21 longwall section (MMU 050). The following conditions have been observed during an ongoing fatal investigation of an accident that occurred on April 5, 2010:

- 1) The #1 Stage Loader motor has grease inside the XP motor. The bearing seal is allowing grease to enter the enclosure.
- 2) The #1 Stage Loader motor has a missing set screw on the plug adapter for the lower entrance gland.
- 3) The #2 Stage Loader motor does not have a set screw on the bottom packing nut. The additional unused entrance gland for this motor is not tack-welded.
- 4) A non-permissible temperature gun has been found in this location. The

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.1002(a)
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or illness (has) (is): No Likelihood Unlikely Reasonably Likely Highly Likely Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays Lost Workdays Or Restricted Duty Permanently Disabling Fatal

C. Significant and Substantial: Yes No

D. Number of Persons Affected: 008

11. Negligence (check one) A. None B. Low C. Moderate D. High E. Reckless Disregard

12. Type of Action 104(d)(2) 13. Type of Issuance (check one) Citation Order Safeguard Written Notice

14. Initial Action A. Citation B. Order C. Safeguard D. Written Notice E. Citation/Order Number 8082692 F. Dated Mo Da Yr 03/17/2009

15. Area or Equipment Stageloader and Crusher Area.

16. Termination Due A. Date Mo Da Yr B. Time (24 Hr. Clock)

Section III--Termination Action

17. Action to Terminate

18. Terminated A. Date Mo Da Yr B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E16 20. Event Number 4440348 21. Primary or Mill

22. Signature Keith McElroy 23. AR Number 24153

MSHA Form 7000-3, Apr 08 (revised) In accordance with the provisions of the Small Business Regulatory Enforcement Fairness Act of 1996, the Small Business Administration has established a National Small Business and Agriculture Regulatory Ombudsman and 10 Regional Fairness Boards to receive comments from small businesses about federal agency enforcement actions. The Ombudsman annually evaluates enforcement activities and rates each agency's responsiveness to small business. If you wish to comment on the enforcement actions of MSHA, you may call 1-888-REG-FAIR (1-888-734-3247), or write the Ombudsman at Small Business Administration, Office of the National Ombudsman, 409 3rd Street, SW MC 2120, Washington, DC 20416. Please note, however, that your right to file a comment with the Ombudsman is in addition to any other rights you may have, including the right to contest citations and proposed penalties and obtain a hearing before the Federal Mine Safety and Health Review Commission.



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input type="checkbox"/> <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 12/06/2011	3. Citation/Order Number 4900516
4. Served To Berman Cornett (Safety Director)	5. Operator Performance Coal Company, et al.	
6. Mine UPPER BIG BRANCH MINE-SOUTH	7. Mine ID 46-08436	(Contractor)

Section II--Justification for Action

Continuation of 8. Condition or Practice

operator says this device is used to perform PM's for the longwall.
 5) Two non-permissible battery-powered grease guns were observed in this location.
 6) The Crusher motor's spare unused packing gland plug is not tack-welded.
 7) A non-permissible battery-powered blasting detonator (REO CD600B-100J) was observed by the Stage Loader.

These conditions constitute more than ordinary negligence by the operator. Non-permissible battery-powered equipment is being used by the operator to perform preventative maintenance on equipment during production shifts in this area. This violation is an unwarrantable failure to comply with a mandatory standard.

This citation is being issued to the following entities as a unitary operator: Performance Coal Company, Massey Coal Services, Inc., A.T. Massey Coal Company, Inc., and Massey Energy Company.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	------------------	------------------------	-------------------------------------	--	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E16	10. Event Number 4440348		
11. Signature Keith McElroy	AR Number 24153	12. Date Mo Da Yr 12/06/2011	13. Time (24 Hr. Clock) 0800