



Section I--Violation Data

1. Date Mo Da Yr 12/06/2011	2. Time (24 Hr. Clock) 0800	3. Citation/ Order Number 8258596
4. Served To Berman Cornett (Safety Director)		5. Operator PERFORMANCE COAL COMPANY, et al
6. Mine UPPER BIG BRANCH MINE-SOUTH		7. Mine ID 46-08436 (Contractor)
8. Condition or Practice		8a. Written Notice (103g) <input type="checkbox"/>

The Continental rectifier/belt starter (no serial number-supplies 500 volts D.C. to three 300 H.P. motors for the "Mother Drive"), does not have the pilot circuits for the three motor cables (labeled as 5A,5B, and 5C) terminated in a proper manner. The 5C pilot is routed through the Emergency stop button on the Continental rectifier/belt starter and is terminated to a ground. The pilot of the 5A and 5B cables are terminated through the Continental Load Break auxiliary switch. The green grounding wires from terminals 1A and 1B are dangling inside the enclosure of the rectifier/starter. The dangling wires are uninsulated at the lugs. The monitor circuits for all three circuits are paralleled in the AEEI transformer (serial #13060-1800-1000). It is possible that the unlanded rectifier/starting boxes auxiliary switch wires can defeat the Emergency

See Continuation Form (MSHA Form 7000-3a)

9. Violation	A. Health <input type="checkbox"/> Safety <input checked="" type="checkbox"/> Other <input type="checkbox"/>	B. Section of Act	C. Part/Section of Title 30 CFR 75.512
--------------	--	-------------------	---

Section II--Inspector's Evaluation

10. Gravity:

A. Injury or Illness (has) (is): No Likelihood  Unlikely  Reasonably Likely  Highly Likely  Occurred

B. Injury or illness could reasonably be expected to be: No Lost Workdays  Lost Workdays Or Restricted Duty  Permanently Disabling  Fatal

C. Significant and Substantial: Yes  No  D. Number of Persons Affected: 001

11. Negligence (check one) A. None  B. Low  C. Moderate  D. High  E. Reckless Disregard

12. Type of Action 104(a) 13. Type of Issuance (check one) Citation  Order  Safeguard  Written Notice

14. Initial Action A. Citation  B. Order  C. Safeguard  D. Written Notice  E. Citation/Order Number F. Dated Mo Da Yr

15. Area or Equipment

16. Termination Due A. Date Mo Da Yr 01/05/2012 B. Time (24 Hr. Clock) 0800

Section III--Termination Action

17. Action to Terminate

18. Terminated A. Date Mo Da Yr B. Time (24 Hr. Clock)

Section IV--Automated System Data

19. Type of Inspection (activity code) E16 20. Event Number 4440348 21. Primary or Mill

22. Signature Patrick Alan Stanfield 23. AR Number 23908



Section I--Subsequent Action/Continuation Data

1. Subsequent Action 1a. Continuation <input type="checkbox"/> <input checked="" type="checkbox"/>	2. Dated (Original Issue) Mo Da Yr 12/06/2011	3. Citation/Order Number 8258596
4. Served To Berman Cornett (Safety Director)	5. Operator PERFORMANCE COAL COMPANY, et al	
6. Mine UPPER BIG BRANCH MINE-SOUTH	7. Mine ID 46-08436 (Contractor)	

Section II--Justification for Action

Continuation of 8. Condition or Practice

stop. The rectifier/starting box schematic does not show the wiring configuration as observed for this installation.

The Continental rectifier/belt starter for the "Mother Drive" is located in an area affected by an explosion on 04.05.2010. The Operator is issued a high number of similar citations upon inspection of the underground electrical equipment, following the explosion.

This citation is being issued to the following entities as a unitary operator: Performance Coal Company, Massey Coal Services, Inc., A.T. Massey Coal Company, Inc., and Massey Energy Company.

See Continuation Form

Section III--Subsequent Action Taken

8. Extended To	A. Date Mo Da Yr	B. Time (24 Hr. Clock)	<input type="checkbox"/> C. Vacated	<input type="checkbox"/> D. Terminated	<input type="checkbox"/> E. Modified
----------------	---------------------	------------------------	-------------------------------------	--	--------------------------------------

Section IV--Inspection Data

9. Type of Inspection E16	10. Event Number 4440348		
11. Signature Patrick Alan Stanfield	AR Number 23908	12. Date Mo Da Yr 12/06/2011	13. Time (24 Hr. Clock) 0800