

CRANDALL CANYON MINE- MAINS WEST SECTION

08/28/2007


DRILL HOLE #3 8-7/8"
 DEPTH- 1,414 FT.
 16.2% Oxygen
 0.0% Methane
 22 ppm Carbon Monoxide
 as per MSHA Log 8/16/07
 Drilling Started: 8/13/07 17:00pm
 Breached Mine: 8/15/07 10:00am
 Total Drill Time: 41 Hours
 Avg Drill Speed: 34.5 Feet Per Hour

DRILL HOLE #4 8-7/8"
 DEPTH- 1,587 FT.
 13.8% Oxygen
 0.0% Methane
 19 ppm Carbon Monoxide
 as per MSHA Log 8/19/07
 Drilling Started: 8/16/07 12:00pm (noon)
 Breached Mine: 8/18/07 09:00am
 Total Drill Time: 45 Hours
 Avg Drill Speed: 35.3 Feet Per Hour

DRILL HOLE #7 8-7/8"
 DEPTH- 1,865 FT.
 % Oxygen
 % Methane
 ppm Carbon Monoxide
 as per MSHA Log 8/ /07
 Drilling Started: 8/28/07 04:00am
 Breached Mine:
 Total Drill Time: Hours
 Avg Drill Speed: Feet Per Hour

LAST KNOWN
 LOCATION
 OF MINERS

1 SEAL BREACH 8/06/07
 6.8% Oxygen
 0.0% Methane
 57 ppm Carbon Monoxide
 as per MSHA Log 8/6/07

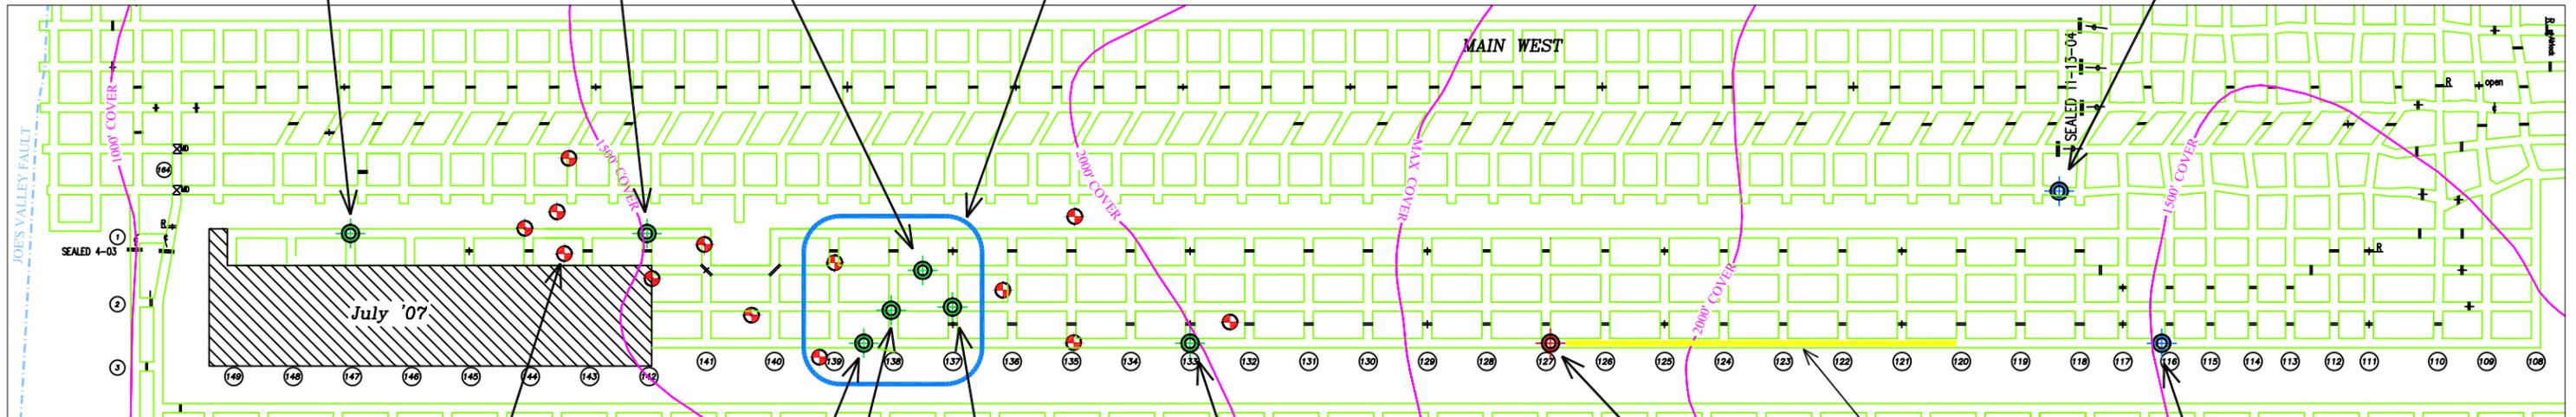

GEO-PHONE
 LOCATIONS
 (TYP OF 13 EA)

DRILL HOLE #6 8-7/8"
 DEPTH- 1,783 FT.
 No Air Samples Available
 Hole Plugged
 Drilling Started: 8/23/07 15:40pm
 Breached Mine: 8/25/07 16:30pm
 Total Drill Time: 49 Hours
 Avg Drill Speed: 36.4 Feet Per Hour

DRILL HOLE #2 8-7/8"
 DEPTH- 1,866 FT.
 Air Quality Readings
 Not Available
 Drilling Started: 8/8/07 19:00pm
 Breached Mine: 8/11/07 01:00am
 Total Drill Time: 53 Hours
 Avg Drill Speed: 35.2 Feet Per Hour

DRILL HOLE #5 8-7/8"
 DEPTH- 2033 FT.
 No Air Samples Available
 Hole Plugged
 Drilling Started: 8/19/07 22:00pm
 Breached Mine: 8/22/07 08:30am
 Total Drill Time: 58.5 Hours
 Avg Drill Speed: 34.9 Feet Per Hour

**ADVANCEMENT
 UP TO 8/16/07**
MUCKING: 940'
PROPS: 870'
 MINING HALTED AT 6:38 P.M. MST
 DUE TO PILLAR BURST AND
 INJURY TO MINERS

ENTRY #1 ADVANCEMENT

AIR QUANTITIES AFTER
 SEISMIC EVENT on 08/06/2007
 XC 116 ENTRY #1
 38,969 CFM
 21.0% Oxygen
 0.0% Methane
 0 ppm Carbon Monoxide
 as per MSHA Log 8/6/07

DRILL HOLE #1 2-1/2"
 DEPTH- 1,871 FT.
 7.4% Oxygen
 0.0% Methane
 172 ppm Carbon Monoxide
 as per MSHA Log 8/10/07
 Drilling Started: 8/7/07 22:00pm
 Breached Mine: 8/09/07 22:00pm
 Total Drill Time: 48 Hours
 Avg Drill Speed: 39.0 Feet Per Hour

UtahAmerican
 Energy, Inc.
 Crandall Canyon Mines

UtahAmerican Energy, Inc.
 Crandall Canyon Mine
 P.O. Box 1877
 Panguitch, Utah 84650
 (435) 686-2500
 Date: Aug. 24, 2007
 Scale: 1" = 100'